DEPARTMENT OF HEALTH AND HU. IN SERVICES CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 08/30/2011 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: A. BUILDING 01 - MAIN BUILDING 01			(X3) DATE SURVEY COMPLETED	
*		445098	B. WIN	G	08/29/2011	
NAME OF PROVIDER OR SUPPLIER NHC HEALTHCARE, KNOXVILLE				STREET ADDRESS, CITY, STATE, ZIP CODE 809 EAST EMERALD AVE KNOXVILLE, TN 37917		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROPE DEFICIENCY)	BE COMPLETION	
K 029 SS=D	One hour fire rated fire-rated doors) or extinguishing system and/or 19.3.5.4 prot the approved automoption is used, the approved system and or spaces by sm doors. Doors are safield-applied protect	construction (with ¾ hour an approved automatic fire in accordance with 8.4.1 sects hazardous areas. When natic fire extinguishing system areas are separated from oke resisting partitions and elf-closing and non-rated or ive plates that do not exceed bottom of the door are	КО	 The unsealed penetrations in the broom ceiling and wall above the hot wheater were sealed on 9/2/11. The Maintenance dept. will visual inspect for other unsealed penetrations boiler room and if found will correct traffected. Maintenance will perform annual inspections of the boiler room to check unsealed penetrations. 	lly s in the he area	
K 062 SS=D	Based on observatifailed to assure hazifire rated construction. The findings include Observation and interpretor, on August confirmed unsealed room ceiling and was heater. NFPA 101 LIFE SAFT Required automatic continuously maintate condition and are insperiodically. 19.7. 25, 9.7.5	erview with the Maintenance 29, 2011 at 2:15 p.m. penetrations in the boiler all above the new hot water ETY CODE STANDARD sprinkler systems are ined in reliable operating spected and tested 6, 4.6.12, NFPA 13, NFPA	K 06	4. The visual inspection and annual inspection will ensure that all correctivactions were effective. 1. The sprinkler head in the walk-in will be replaced prior to completion day. 2. The center only has I walk-in coo Once this is corrected, there will be no to identify the same issue in another location. 3. Maintenance dept. will visually in the sprinkler head in the walk-in cooler future corrosion. 4. Periodic visual inspections of the sprinkler head should ensure this will not be action.	cooler te. 9/15/2011 ler. need 7-1-11 spect for	
POBATORY		and 5.2.1.1.2 Any sprinkler	ATURE	reoccur.	(X6) DATE	

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

SEP 0 9 2011

9-9-2011

DEPARTMENT OF HEALTH AND HL N SERVICES CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 08/30/2011 FORM APPROVED OMB NO. 0938-0391

AND PLAN OF CORRECTION		IDENTIFICATION NUMBER:	A. BUILDING 01 - MAIN BUILDING 01		COMPLETED	
	ii.	445098	B. WIN	G	08/29/2011	
NAME OF PROVIDER OR SUPPLIER NHC HEALTHCARE, KNOXVILLE				STREET ADDRESS, CITY, STATE, ZIP CODE 809 EAST EMERALD AVE KNOXVILLE, TN 37917		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORREC (EACH CORRECTIVE ACTION SHO CROSS-REFERENCED TO THE APPR DEFICIENCY)	SHOULD BE COMPLETION	
K 062	shall be replaced the painted, corroded, comproper orientation. Based on observating failed to assure spring corrosion. The findings included Observation and interpreted on August confirmed the spring was corroded. NFPA 101 LIFE SA	at has signs of leakage; is damaged, or loaded; or in the n. on and interview, the facility nkler heads were free of e: erview with the Maintenance 29, 2011 at 2:50 p.m. kler head in the walk-in cooler FETY CODE STANDARD uishers are provided in all ncies in accordance with	Ko		ect the	
K 144 SS=E	Based on observatifailed to assure fire the requirements of The findings include Observation and interpreters on August confirmed the CO2 boiler room failed to test (NFPA 10-5.2) at The last hydrostatic January 2005. NFPA 101 LIFE SAF	erview with the Maintenance 29, 2011 at 2:25 p.m. fire extinguisher located in the have a 5-year hydrostatic and annual conductivity test. test was performed in FETY CODE STANDARD ected weekly and exercised nutes per month in	K 14	 Maintenance will work with the extinguisher contractor during the alinspections to ensure compliance. The maintenance dept. will ensure compliance by accompanying the freextinguisher on annual inspections. 	nnual	

PRINTED: 08/30/2011 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULT A. BUILDIN	TIPLE CONSTRUCTION NG 01 - MAIN BUILDING 01	(X3) DATE SURVEY COMPLETED	
1		445098	B. WING _		08/2	9/2011
NHC HE	PROVIDER OR SUPPLIER ALTHCARE, KNOXVIL		8	REET ADDRESS, CITY, STATE, ZIP CODE 809 EAST EMERALD AVE KNOXVILLE, TN 37917		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRE (EACH CORRECTIVE ACTION SH CROSS-REFERENCED TO THE API DEFICIENCY)	IOULD BE	(X5) COMPLETION DATE
K 144	This STANDARD is Based on record refailed to assure the shall be tested twelvesting intervals between exceeding 40 days. (3-4.4.1.1 (b) 1. The findings include Record review of the with the Maintenance 2011 at 1:00 p.m. or run under load mont frequency (between exceeding 40 days).	not met as evidenced by: view and interview, the facility emergency generator sets e (12) times a year with veen not less than 20 days or NFPA 99, 3-6.4.1.1.(b) and e Emergency Generator logs e Director, on August 29, onfirmed the Generator was hly, outside of the required not less than 20 days or Record review of actual logs 48, 7, 50, 6, 47, and 7 days	K 144		e generator ithin the ensure uirements when	9/15/2017 10-15-2011 9-9-11
		•	ē.			